


2016 Chevrolet Camaro V8-6.2L

T3 AUDIO AMPLIFIER X2 (UQA)

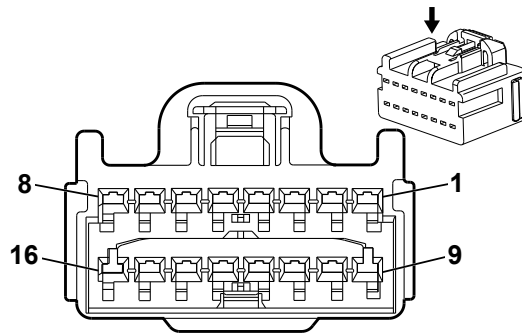

Connector Part Information

- Harness Type: Body
- OEM Connector: 89047090
- Service Connector: 89047090
- Description: 16-Way F 1.5 Kaizen Series (GN)

Terminal Type ID	Terminated Lead	Diagnostic Test Probe	Terminal Removal Tool	Service Terminal	Tray Name	Core Crimp	Insulation Crimp
I	13575850	J-35616-2A (GY)	J-38125-11A	Not Available	Not Available	Not Available	Not Available

Terminal Part Information

Pin	Size	Color	Circuit	Function	Terminal Type ID	Option
1 - 2	—	—	—	Not Occupied	—	—
3	1	YE/WH	1860	Front Center Speaker Control (+)	I	—
4	1	BN/GN	1852	Right Front Tweeter Speaker Control (+)	I	—
5	1	YE/BU	1856	Left Front Tweeter Speaker Control (+)	I	—
6	1	WH	46	Right Rear Speaker Control (+)	I	—
7	1	GN	199	Left Rear Speaker Control (+)	I	—
8	1	GY/BK	315	Right Subwoofer Speaker (-) Low Reference	I	—
9 - 10	—	—	—	Not Occupied	—	—
11	1	BU/YE	1960	Front Center Speaker (-) Low Reference	I	—
12	1	VT/BN	1952	Right Front Tweeter Speaker (-) Low Reference	I	—
13	1	YE/GY	1956	Left Front Tweeter Speaker (-) Low Reference	I	—
14	1	BU/BK	115	Right Rear Speaker Signal (-)	I	—

Pin	Size	Color	Circuit	Function	Terminal Type ID	Option
15	1	GN/BK	116	Left Rear Speaker Signal (-)	I	—
16	1	GN/VT	1795	Right Subwoofer Speaker Control (+)	I	—